

Roger Linn Design Repair Instructions
March 1, 2008

On any AdrenaLinn I, II or III that contains a headphone jack, if the customer complains of random static noise in the PHONES output only (not in the main stereo outputs), the problem can be corrected by connecting a jumper between pin 5 of the headphone amp (U16) to the nearby ground pin of the PHONES jack. This jumper is shown in the picture below by the red line.

